

Date: Monday, 4/30/2007 7:23:56 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services

Drawing Name : 412 X-TUBE INST, LOW NARROW AFT

Job Number : 32109

Estimate Number : 12817

P.O. Number : N/A

This Issue : 4/30/2007

S.O. No. : N/A

Prsht Rev. : NC

First Issue : N/A

Type : LANDING GEAR

Previous Run : 32108

Part Number : D412664205

Drawing Number : D412-664 UNDER REV

Project Number : N/A

Drawing Revision : URC

Material : N/A

Due Date : 5/4/2007

Qty: 1 Um: Each

Written By :

Checked & Approved By :

Comment : Est Rev. A New Issue 07-04-05 JLM

Additional Product

Job Number:

Seq. #:

Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL

Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D412-664-205 CHG001

2.0

PACKAGING 1

PACKAGING RESOURCE #1

Comment: PACKAGING RESOURCE #1

Pick Packing Kit

3.0

D412664245

CROSSTUBE ASSEMBLY, LOW NARROW AFT, 412C

Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Crosstube 412 Low

Batch: 331598

4.0

AN640A

Bolt

Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: 119185

5.0

AN641A

Bolt

Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: 1102428

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: AD Date: 07/05/04
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 4/30/2007 7:23:56 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 412 X-TUBE INST, LOW NARROW AFT

Job Number: 32109

Part Number: D412664205

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

MS21042L6

Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Nut

Batch: M101660 ✓

7.0

AN960JD616

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Washer

Batch: M103395 ✓

7/5/3/ Sep

8.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

C207105/03 (1)

C207105/03 (1)

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Identify and pack for shipping as per PPP D412-664-105

REV: Draft
E207105/04 Sep

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

E207105/04 (1)

Job Completion



31598

U 07.05.04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN 90	DRAWN BY 90	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED H	APPROVED H	DRAWING NO. D412-664-245	REV. C SHEET 1 OF 3
DATE 07.03.29		TITLE CROSSTUBE ASS'Y (412 LOW-N AFT) NTS	
A	06.12.01	NEW ISSUE	
B	07.03.01	CHG CUFF AREA, CHG RUBBER CUSHION	
C	07.03.29	CHG RIVET AND RUBBER CUSHION	

RELEASED

07.04.24 H

PARTS LIST:

Qty	Part Number	Description
X	D412-664-245	CROSSTUBE ASSEMBLY (412 LOW-NARROW AFT)
1	D6009-129	CROSSTUBE
2	D2856-600-1009	ABRASION STRIP
1	D2896-1	SUPPORT
2	D3189-1	CHAFING SHIELD
2	D3595-063-570	RUBBER CUSHION
2	D3606-1	CUFF
44	CR3212-4-07	RIVET (OR M7885/3-4-07)
4	MS21920-28	CLAMP
2	MS21920-30	CLAMP (OR MS21920-32)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
A/R	SIKAFLEX-241/-291	SEALANT (OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT)

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 123.59±0.020 (BEFORE BENDING/TRIMMING)
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D., EXCEPT UP TO 10% IS ALLOWED IN AREA NOTED.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-600-1009 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
- 13) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.
- 14) INSTALL D3606-1 CUFF AFTER CHEMICAL CONVERSION COAT BUT BEFORE PAINT, WITH A LAYER OF SIKAFLEX-241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT BETWEEN CUFF AND CROSSTUBE. SEAL EDGE OF CUFF TO ENSURE NO GAPS.
- 15) TOUCH-UP HOLES WITH CHEMICAL CONVERSION COAT.


TOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32109

Copyright © 2006 by DART AEROSPACE LTD


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED


07.04.24

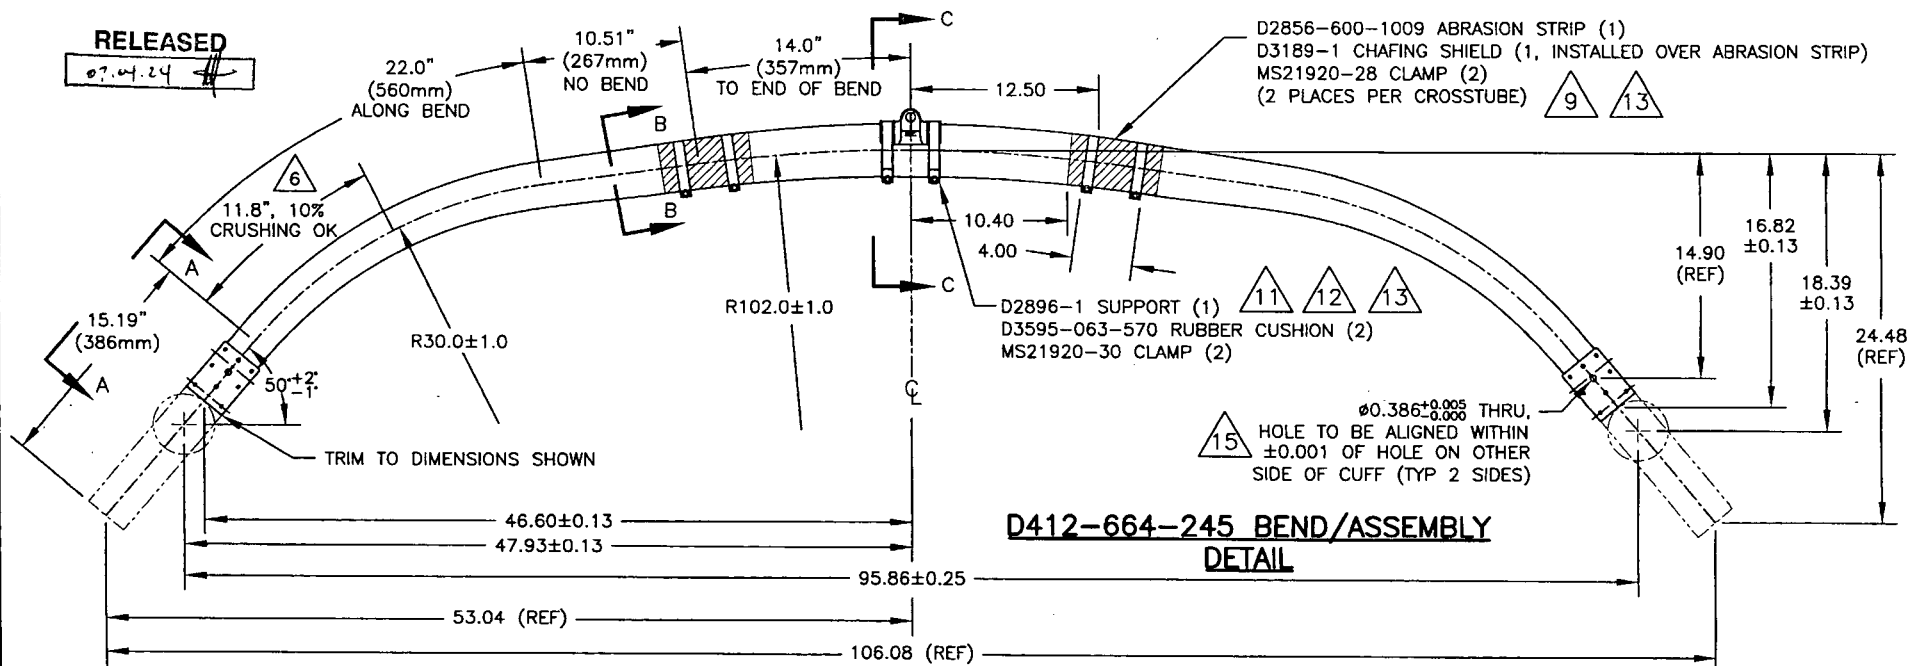

**D412-664-245 BEND/ASSEMBLY
DETAIL**

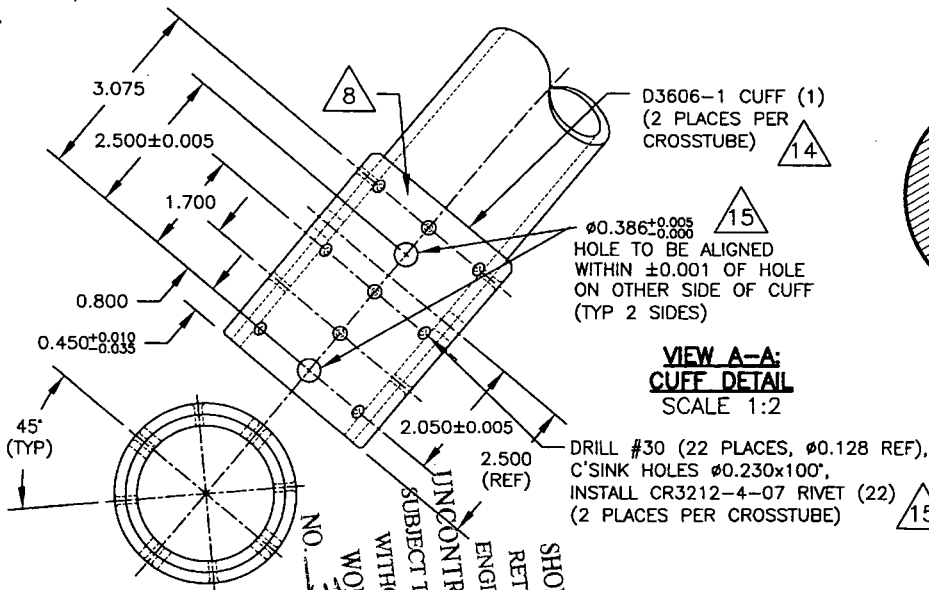

**VIEW A-A:
CUFF DETAIL
SCALE 1:2**

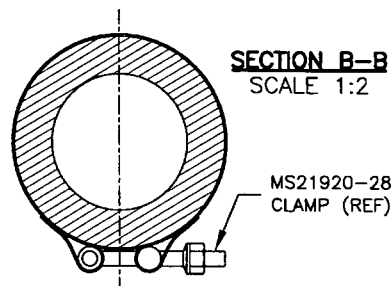

**SECTION B-B
SCALE 1:2**

APPLY MAGNOBOND
BETWEEN D2896-1 AND
THE CROSSTUBE


11

D2896-1
SUPPORT
(REF)

D3595-063-570
RUBBER CUSHION
(UNDER CLAMP, REF)

MS21920-30
CLAMP (REF)

**SECTION C-C
SCALE 1:2**

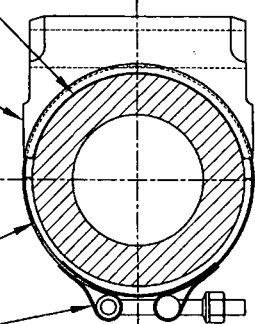

COPYRIGHT © 2008 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN
07
CHECKED
07
DATE
07.03.29

DART


DART AEROSPACE LTD.
WINDSOR, ONTARIO, CANADA

DRAWING NO.
D412-664-245

TITLE
CROSSTUBE (412 LOW-NARROW AFT)

REV. C
SHEET 2 OF 3
SCALE
1:8

NO. 32109
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOW COPY

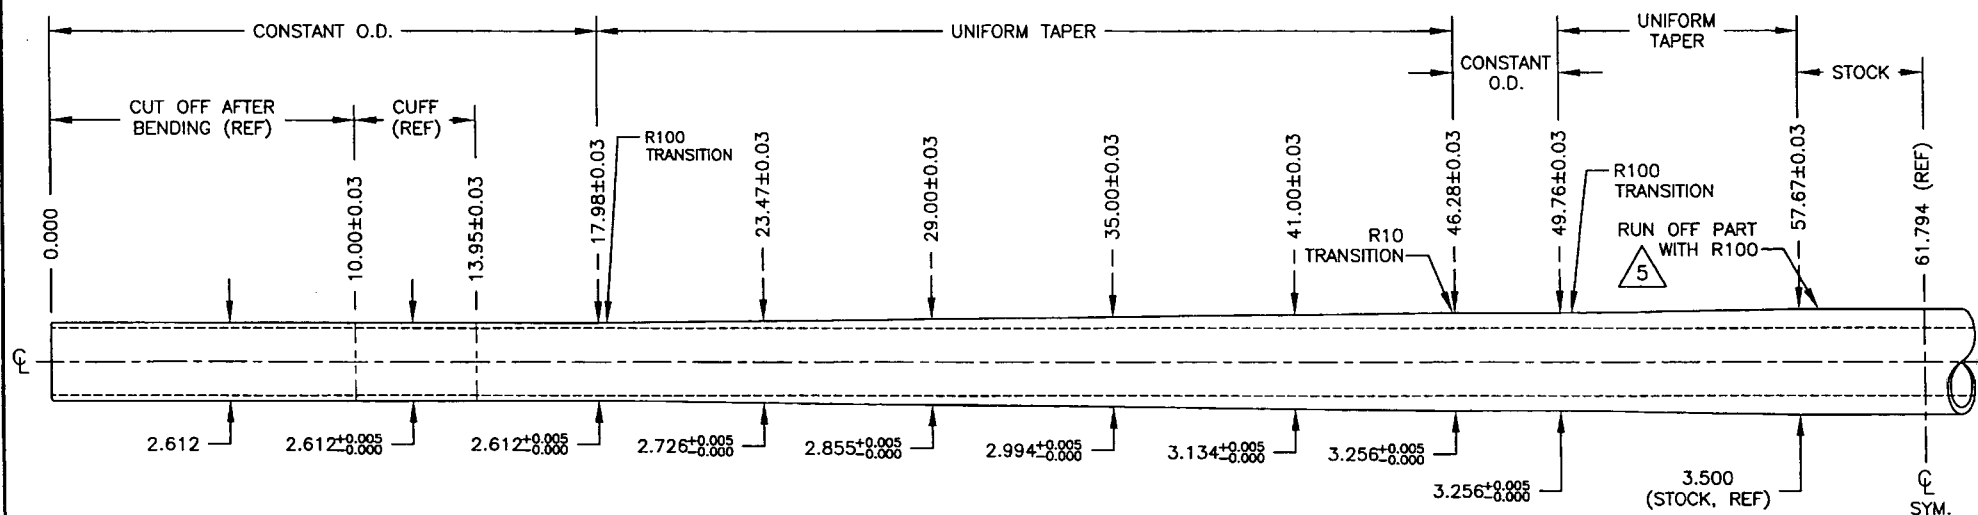

D412-664-245 MACHINING DETAIL

RELEASED

07.04.19

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32107

COPYRIGHT © 2008 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN qp	DRAWN BY qp	DART	DART AEROSPACE LTD. HAMPSHIRE, ONTARIO, CANADA
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D412-664-245	REV. C SHEET 3 OF 3
DATE 07.03.29	TITLE CROSSTUBE (412 LOW-NARROW AFT)	SCALE 1:4	